

## **List of Recalls and Replacement Parts for Child Restraints**

Revised January 29, 2012

A recall has been added for Britax Chaperone.

### **How can you tell if your safety seat is safe?**

Make sure the safety seat is less than 10 years old (preferably less than five), the expiration date stamped on the plastic has not passed, and it has never been used in a crash. You can't be sure about the history of a used seat unless you got it from a friend or relative. You will need the detailed instruction booklet (it can be ordered from the manufacturer if it is missing) to check that the seat has all of its parts and to find out how to use it correctly. Check for possible damage, such as cracks in the plastic, frayed straps, stiff buckles or harness adjusters. If the safety seat passes all of these criteria, you still need to check for possible recalls.

### **What is a safety seat recall?**

Just like cars and other products, a safety seat may be "recalled" because of a defect that could injure your child. Manufacturers are required to fix the problem free of charge. If your seat is recalled, be sure to get it fixed right away.

### **Does the safety seat have to be sent back?**

Not usually. Most problems can be fixed by replacing a part that the manufacturer will send you for free. Sometimes, with an older seat or when the company is out of business, you may need to destroy it. To make sure it is not picked up by someone and used by another child, you should break it with a sledgehammer, crush it, or take it completely apart and mark it "not for use as a safety seat" before throwing it away wrapped securely in a heavy trash bag.

### **Should I keep using a recalled seat?**

Many defects are minor, but some are quite serious. All problems should be corrected as soon as possible. Unless you have another seat, you should go on using the recalled one while you are waiting for the repair kit. Using a recalled safety seat almost always is safer than letting your child ride in a safety belt only.

## **How to check your safety seat for recalls**

1. Look up the name of the manufacturer.
2. Look up the name of your specific model. Important: the model name may not be found anywhere on the seat, and many safety seats have similar model names. Some infant-only seats are sold as a part of a stroller system. Since stroller model names are not included on this list, it is necessary to determine the name of the corresponding infant seat to be sure all recalls and warnings have been found. Some manufacturers have style names (i.e., Oshkosh, Disney characters, etc.) sewn on the fabric or used in promotional materials. These names are used for more than one product and cannot be used to determine whether or not the seat has a recall. If you are not sure of the exact name of your seat, check the Color Pictorial Guide to Child Restraints (view at [www.carseat.org](http://www.carseat.org) or order hard copy from SafetyBeltSafe U.S.A.) or contact the manufacturer or SafetyBeltSafe U.S.A. to help you identify it.
3. If you are sure of the EXACT name of your seat, you are ready to look it up on the recall list. Every model made since 1981 is on the list, either with a recall or under the "no recall" section at the end of each manufacturer's section. Even if there is no recall, do not use a safety seat that is more than 10 years old (under 5 years is recommended). Manufacturer "expiration dates" range from 5 to 8 years.
4. If your model has a recall listed, you need to compare the date of manufacture of your particular seat with the dates affected by the recall. The date is stamped on a paper sticker attached to the side or the back of the seat. Disregard dates on tags attached to the fabric cover, embossed in the plastic shell, or pre-printed in the corner of certification or instruction labels. For some recalls, you also will need to check the model number, which is found on the same sticker as the date. If the date sticker is missing or the date is not clearly marked, assume that all possible recalls apply to your seat.

## Special Features of the *SafetyBeltSafe* U.S.A. List of Recalls and Replacement Parts for Child Restraints

1. New recalls are added to this list as soon as they can be verified. Recall Update Service subscribers receive notification by e-mail. To verify that a printed copy of this list is current, go to [www.carseat.org](http://www.carseat.org) and click on Recalls (left frame) or call 310-222-6860.
2. Voluntary customer notification campaigns, special warnings, and additional replacement parts available from manufacturers are included on the list. Some of these are not widely announced and are provided for the benefit of parents and child restraint checkers. The bracketed phrase [Not publicized] indicates usage advice or repair kit availability that has been verified with but not announced by the manufacturer. If a child restraint with one of these problems or any defect which has not been recognized with an official recall is found, it is important to notify officials responsible for defect investigations. To report a defect, call the National Highway Traffic Safety Administration (NHTSA) at 888-327-4236 or 800-424-9393 or go to <http://www-odi.nhtsa.dot.gov/ivoq>.
3. Recall wording including manufacturer contact information, has been clarified and updated. The "Problem" is described clearly and briefly. The wording under "Action Needed" is based on current information supplied by the manufacturer instead of the original recall notice, which may contain ambiguous or obsolete information.
4. Model names are listed alphabetically. For ease of use and accuracy, all recalls are grouped by the model name of the restraint. Model numbers are also listed, if provided by the manufacturer.
5. All child restraints made since 1981, with or without a recall, are listed, with those not made within the past 10 years identified separately at the end of each manufacturer's section. This is followed by a list of the child restraints with no recalls in effect. This feature saves time, since it allows parents and checkers to know "when to stop." It can also prevent the dangerous error of assuming a child restraint is not recalled because the model name is not found.
6. When problems with instruction booklets are identified, corrections and updates are obtained from manufacturers and added to the list.

### Child Restraint Manufacturer Recalls and Free Replacement Parts

| MFR.   | MODEL NAME<br>(MODEL #)  | DATES<br>APPLICABLE  | PROBLEM   | ACTION REQUIRED  |
|--|--|--|---|--|
| <b>All Our Kids (out of business)</b>  |  |  |   |  |
| All Our Kids   | Do not use <b>All Our Kids</b> Travel Vest. All made more than 10 years ago; many had recalls. |  |   |  |
| <b>Angel Guard Products, Inc. (c/o Mercury Distributing, 7001 Wooster Pike, Medina, OH, 800-815-6330)<br/><a href="http://www.angel-guard.com">www.angel-guard.com</a></b> |  |  |   |  |
| <b>Angel Guard model with no recalls, replacement parts, or warnings: AngelRide Infant Car Bed</b>   |  |  |   |  |
| <b>Aprica 3 Glenlake Parkway, Atlanta, GA 30328, 888-927-7422 <a href="http://www.aprica.com">www.aprica.com</a></b>   |  |  |   |  |
| <b>Aprica model with no recalls, replacement parts, or warnings: A30</b>   |  |  |   |  |
| <b>Baby Trend, Inc., 1607 S. Campus Ave., Ontario, CA 91761, 800-328-7363, <a href="http://www.babytrend.com">www.babytrend.com</a></b>                                    |  |  |   |  |
| Baby Trend   | Rigid Latch-Loc 6439, 6448, 6481 and Latch-Loc Base 6400                                       | 5/14/07 to 4/1/08  | LATCH connector metal locking parts can crack, allowing connectors on the base to release from vehicle anchors in a severe crash. | Call 800-328-7363 for replacement Flex-Loc Base in exchange for Rigid Latch-Loc Base. Until replaced, secure base or seat alone with vehicle belt. |
| <b>Baby Trend models with no recalls, replacement parts, or warnings: Baby Trend Booster, EZ Flex-Loc, EZ-Loc, Euro Sport, Fast Back, Flex-Loc</b>                         |  |  |   |  |
| <b>Babyhood Manufacturing Co. (out of business)</b>  |  |  |   |  |
| Do not use Babyhood Baby Sitter, Wonda Chair #810. All made more than 10 years ago; many had recalls.  |  |  |   |  |
| <b>Basic Comfort, 445 Lincoln St., Denver, CO 80203, 800-456-8687, <a href="http://www.basiccomfort.com">www.basiccomfort.com</a></b>                                      |  |  |   |  |
| Basic Comfort  | Galaxy 2000 (#960, #961)   | Many seats are more than 10 years old or have been recalled. Do not use if more than 10 years old or if date is unknown. |   |  |
| <b>Bergeron Health Care, 15 South Second Street, Dolgeville, NY 13329, 800-371-2778, <a href="http://www.adaptivemall.com">www.adaptivemall.com</a></b>                    |  |  |   |  |
| <b>Bergeron model with no recalls, replacement parts, or warnings: Special Tomato</b>  |  |  |   |  |
| <b>Bobby-Mac. See Evenflo.</b>   |  |  |   |  |

| MFR.  | MODEL NAME<br>(MODEL #)                        | DATES<br>APPLICABLE     | PROBLEM   | ACTION REQUIRED   |
|---|--|-------------------------|---|---|
| <b>Britax Child Safety, 13501 So. Ridge Dr., Charlotte, NC 28273, 888-427-4829, www.britaxusa.com</b> |  |                         |   |   |
| Britax  | Advantage (E9022)                              |                         | Many seats are more than 10 years old or have been recalled. Do not use if more than 10 years old or if date is unknown.  |   |
| Britax  | Advocate 70 CS                                 | All made before 10/5/10 | Button on vehicle belt webbing may interfere with lock-off. Use of 2 lock-offs required unless friction material is present. [Not a recall]   | Pre-7/30/10: Call for friction strips if button on belt interferes with lock-off. 7/30-10/4/10: Call for revised instructions to use only lock-off next to buckle (friction material present).  |
| Britax  | Advocate 70 CS                                 | 7/1/2010 to 8/31/2011   | A screw and washer in the base joint connector may be missing (does not affect performance). [Not a recall]   | Call Britax for more information and replacement kit, if needed.  |
| Britax  | Boulevard (E9L57)                              | 3/1/06 to 8/1/06        | In some crash tests with the weighted 6-yr dummy (65 lb), the tether hook opened or broke. When it broke, the recline position changed, which is prohibited by FMVSS 213.                                   | To comply with the federal standard, Britax has notified owners that top tether use should be discontinued when the child weighs more than 50 lb. Call Britax for add-on labels. Britax has informed SafetyBeltSafe U.S.A. that performance actually improved when the tether hook opened during crash tests. |
| Britax  | Boulevard 70, Boulevard 70 CS                  | All made before 10/5/10 | Button on vehicle belt webbing may interfere with lock-off. Use of 2 lock-offs required unless friction material is present. [Not a recall]   | Pre-7/30/10: Call for friction strips if button on belt interferes with lock-off. 7/30-10/4/10: Call for revised instructions to use only lock-off next to buckle (friction material present).  |
| Britax  | Boulevard 70, Boulevard 70 CS                  | 7/1/2010 to 8/31/2011   | A screw and washer in the base joint connector may be missing (does not affect performance). [Not a recall]   | Call Britax for more information and replacement kit, if needed.  |
| Britax  | Chaperone (E9L69N9, E9L69P2, E9L69P3, E9L69P5) | 4/1/09 to 5/31/10       | Chest clip may break when engaged, causing risk of laceration or choking on small piece.  | Call for new chest clip.  |
| Britax  | Chaperone (E9L692J, E9L692K, E9L692L, E9L692M) | 9/1/2010 to 4/30/11     | Harness adjuster may detach from shell due to improperly installed rivet. If adjuster is detached, do not use seat until repaired.  | Call to order repair kit.   |
| Britax  | Companion (E9L14)                              | 10/31/03 to 6/6/04      | Incorrectly assembled carrier may allow too much forward rotation in an impact due to improper seating of the carrier in the base.  | Call to see if the carrier and base must be replaced. In the interim only use the carrier without the base.   |
| Britax  | Companion (E9L14, E9L20, E9L80)                | All made before 11/1/07 | Instructions have been revised to specify use of inner crotch strap location for children under 11 lb and to change the maximum head height to one inch from top of restraint shell.                        | Call Britax or go to its Web site to receive revised instructions and labels.   |
| Britax  | Decathlon (E9L47)                              | 2/12/05 to 7/31/07      | If harness adjuster strap is pulled from the side, the plastic housing around the release button may come loose, allowing the adjuster to move out of position and making the harness difficult to tighten. | Call for repair kit consisting of push rivet fasteners to keep harness adjuster in position.  |

| MFR.   | MODEL NAME (MODEL #)                         | DATES APPLICABLE   | PROBLEM   | ACTION REQUIRED  |
|--------|--|--|---|--|
| Britax | Freeway                                      | Many seats are more than 10 years old or have been recalled. Do not use if more than 10 years old or if date is unknown. |   |  |
| Britax | Frontier (model numbers starting with E9L54) | 4/1/08 to 9/14/08 (black harness)<br>4/1/08 to 9/17/08 (beige harness)   | When loosening harness by pulling on only one strap, straps may become detached from harness yoke (splitter plate) on back of seat, resulting in child not being restrained.  | Call for repair kit with plastic pieces to cover harness yolk ends. Instructions state to always pull on both straps when loosening harness.   |
| Britax | Husky  | All  | LATCH belt path may be used if lap-shoulder belt is too short for belt path shown in instructions (tether must be attached). Recline bar is not required if top tether is attached, regardless of type of lower installation used. [Not publicized] |  |
| Britax | Husky  | All  | Use of the long belt path with a lap belt only may allow excessive forward head movement in a crash.  | Call for new labels and instructions; use the short belt path with recline bar.  |
| Britax | Husky  | All through 7/23/04  | The adjuster strap may slip, allowing the harness to loosen.  | Do not use if harness can be loosened by pulling on straps without lifting release lever. Call for replacement adjuster strap with thicker weave pattern.  |
| Britax | Marathon                                     | All through 7/23/04  | The adjuster strap may slip, allowing the harness to loosen.  | Do not use if harness can be loosened by pulling on straps without lifting release lever. for replacement adjuster strap with thicker weave pattern.   |
| Britax | Marathon (E9L06, E9W06, E906)                | 5/23/06 to 7/28/06   | Tether hook may open in a crash, allowing possible head injury. Applicable only if child is over 50 lb and tether hook is stamped KGR01A.   | Call for replacement tether hook.  |
| Britax | Marathon 70                                  | All made before 10/5/10  | Button on vehicle belt webbing may interfere with lock-off. Use of 2 lock-offs required unless friction material is present. [Not a recall]   | Pre-7/30/10: Call for friction strips if button on belt interferes with lock-off. 7/30-10/4/10: Call for revised instructions to use only lock-off next to buckle (friction material present).               |
| Britax | Marathon 70                                  | 7/1/2010 to 8/31/2011  | A screw and washer in the base joint connector may be missing (does not affect performance). [Not a recall]   | Call Britax for more information and replacement kit, if needed.   |
| Britax | Regent (E9L3998)                             | 12/18/06 to 1/18/07  | Incorrect warning label on cover.   | Call for replacement cover.  |
| Britax | Regent (E9L39)                               | All made before 6/18/07  | Manufacturer has modified the seat and instructions to enhance performance.   | Call for kit with new instructions, label, longer LATCH strap, and adhesive slip-resistant strips. Use long belt path for children 22-40 lb, short path for 40-80 lb. Use recline bar for all installations. |
| Britax | Roadster                                     | All  | Preferred shoulder belt routing is <i>under</i> the arm rest. (Instructions prior to 12/03 show routing over the arm rest.) [Not publicized]  |  |
| Britax | Roundabout (161)                             | Many seats are more than 10 years old or have been recalled. Do not use if more than 10 years old or if date is unknown. |   |  |
| Britax | Roundabout 55                                | All made before 10/5/10  | Button on vehicle belt webbing may interfere with lock-off. Use of 2 lock-offs required unless friction material is present. [Not a recall]   | Pre-7/30/10: Call for friction strips if button on belt interferes with lock-off. 7/30-10/4/10: Call for revised instructions to use only lock-off next to buckle (friction material present).               |

| <b>MFR.</b>   | <b>MODEL NAME (MODEL #)</b>  | <b>DATES APPLICABLE</b> | <b>PROBLEM</b>   | <b>ACTION REQUIRED</b>  |
|---|--|-------------------------|--|---|
| Britax  | Roundabout 55  | 7/1/2010 to 8/31/2011   | A screw and washer in the base joint connector may be missing (does not affect performance). [Not a recall]  | Call Britax for more information and replacement kit, if needed.  |
| Britax  | Super Elite  | 4/25/01 to 2/15/02      | Harness may allow excessive forward head movement in a crash.  | Call for harness replacement kit with HUGS (friction pads, chest clip, and D-rings for adjustment).   |
| Britax  | Super Elite (E9031)  | 4/1/01 to 8/31/02       | Harness release lever may stick, allowing adjuster strap to slip and harness to loosen.  | Call for adjuster strap guide. Push release lever down to make sure it is locked before each use until repaired.  |
| Britax  | Wizard   | All through 7/23/04     | The adjuster strap may slip, allowing the harness to loosen.   | Do not use if harness can be loosened by pulling on straps without lifting release lever. Call for replacement adjuster strap with thicker weave pattern. |
| <b>Britax models with no recalls, replacement parts, or warnings:</b> Advocate, Advocate CS, B-Safe, Baby Safe, Bodyguard, Boulevard CS, Cruiser, Diplomat, Elite, Expressway, Frontier 85, Frontier 85 SICT, Handle with Care, King, Laptop, Marathon CS, Monarch, Parkway (all models), Roundabout 50, Starriser. |  |                         |  |   |
| <b>BubbleBum, 7380 Sand Lake Road, Suite 500, Orlando, Florida, 32819, 800-969-6586, www.bubblebum.us</b>   |  |                         |  |   |
| <b>BubbleBum models with no recalls, replacement parts, or warnings:</b> BubbleBum Booster  |  |                         |  |   |
| <b>Car Seat Specialty. See Team-Tex America</b>   |  |                         |  |   |
| <b>Carter's. See Kolcraft.</b>  |  |                         |  |   |
| <b>Century. See Graco Children's Products.</b>  |  |                         |  |   |
| <b>Champion Children's Products. See Renolux.</b>   |  |                         |  |   |
| <b>Chicco, 1842 William Penn Way, Ste 101, Lancaster, PA 17601, 877-424-4226, www.chiccousa.com</b>   |  |                         |  |   |
| Chicco  | KeyFit, KeyFit 30, or Cortina Travel System (base only)            | 2/26/08 to 3/17/08      | Some bases have a defect that can prevent achieving a tight fit when LATCH is used for installation.   | Call 800-807-8817 to order new base. Use vehicle belt for installation until new base is received.  |
| <b>Chicco models with no recalls, replacement parts, or warnings:</b> KeyFit Strada   |  |                         |  |   |
| <b>Clek Inc., 12 Upjohn Road, Suite 1, Toronto, Ontario M3B 2V9, Canada 248-284-2462, clekinc.com</b>   |  |                         |  |   |
| <b>Clek models with no recalls, replacement parts, or warnings:</b> Olli, Oobr, Ozzi  |  |                         |  |   |
| <b>Collier-Keyworth (out of business)</b>   |  |                         |  |   |
| Do not use <b>Collier-Keyworth</b> Co-Pilot, Cuddle Shuttle, Roundtripper, Safe & Sound, Safe & Sound II. Voyager. All made more than 10 years ago; many had recalls.   |  |                         |  |   |
| <b>Columbia Medical, 13577 Larwin Circle, Santa Fe Springs, CA 90670 800-454-6612, www.columbiamedical.com</b>  |  |                         |  |   |
| <b>Columbia models with no recalls, replacement parts, or warnings:</b> #2000, #2500, Spirit (#2400)  |  |                         |  |   |
| <b>Combi USA, 3520 Westinghouse Blvd. , Suite B, Charlotte, NC 28273, 800-992-6624, www.combiusa.com</b>  |  |                         |  |   |
| Combi   | Avatar   | 11/12/03 to 5/7/04      | LATCH strap, when used with seat rear-facing, could be severed in a crash.   | Call for replacement part. Use vehicle belt when seat is facing rearward until replaced.  |
| Combi   | Centre & Shuttle (#8065, 8074, 8086, 8087, 8520, 4400, 4515, 4520) | 10/19/05 to 12/15/07    | Based on testing at speeds higher than required by federal standard, safety seat shell could separate from base in frontal collision. Combi states no injuries have been reported. | Call 800-543-7734 or go to Combi Web site to order retrofit kit. Until modification is completed, use seat without base.                                  |
| <b>Combi models with no recalls, replacement parts, or warnings:</b> Apogee, Baby One, Baby Ride, Cocco, Connection, Dakota, Everest, HighRide, Kobuk, Kobuk Air-Thru, McKinley, Navette 22, Polo, Saratoga, Shuttle 33, Tyro, Tyro II, Victoria, Yorktown, Zeus 360, Zeus Turn.                                    |  |                         |  |   |
| <b>Compass. See Learning Curve.</b>   |  |                         |  |   |
| <b>Cosco. See Dorel Juvenile Group.</b>   |  |                         |  |   |

| MFR.  | MODEL NAME (MODEL #)   | DATES APPLICABLE   | PROBLEM  | ACTION REQUIRED  |
|---|--|--|--|--|
| <b>Cybox c/o Regal Lager, 1100 Cobb Place Blvd., Kennesaw, Georgia 30144, 800-593-5522, www.regallager.com</b>  |  |  |  |  |
| Cybox   | Solution X-fix booster   | 2/1/10 to 2/28/10  | Incorrect label states that unoccupied booster may be attached with LATCH only. Vehicle belt must be attached.   | Call manufacturer for new label.   |
| <b>Cybox models with no recalls, replacement parts, or warnings: Aton</b>   |  |  |  |  |
| <b>Diono LLC, 3104 142<sup>nd</sup> Ave. East, Suite 105, Sumner, WA 98390, 888-336-7909, www.diono.com</b>   |  |  |  |  |
| <b>Diono or Sunshine Kids models with no recalls, replacement parts, or warnings: Monterey, all Radian models (65, 65SL, 80, 80SL, XT, XTSL, R100, R120, RXT), Snug Seat Pilot, Santa Fe.</b> |  |  |  |  |
| <b>Dorel Juvenile Group, 2525 State St., Columbus, IN 47201, 800-544-1108, www.djgusa.com</b>   |  |  |  |  |
| Note: Dorel is the parent company for Cosco, Eddie Bauer, Maxi-Cosi, Safety 1 <sup>st</sup> , Alpha Elite, and Alpha Sport brands. Some models are marketed with multiple names.              |  |  |  |  |
| Dorel   | Some infant seats sold with travel systems (rear adjust only).   | 1/6/08 to 4/6/09 "Made in China" on label.   | Handle may detach as screws loosen, allowing baby to fall out of seat.   | Call 866-762-3316 for repair kit. Do not use handle until repaired. Does not apply to all model numbers; check with Dorel. |
| Dorel   | 3-In-1   | See Alpha Omega.   |  |  |
| Dorel   | 3 Phase (22-453, 22-452)   | 11/1/03 to 12/31/05  | Adjuster strap may slip in a crash, allowing the harness to loosen.  | Call 800-219-0509 or go to Dorel Web site to order kit with replacement harness adjuster strap.                            |
| Dorel   | Adjustable Highback Booster  | See Prospect.  |  |  |
| Dorel   | All in One   | See Alpha Omega.   |  |  |
| Dorel   | Alpha Luxe   | See Alpha Omega Elite.   |  |  |
| Dorel   | Alpha Omega (22150, -52, -59, -72, -77, -78, -85, 22412, -59, -69)                                     | 5/1/08 to 4/30/09  | Harness may gradually loosen during normal use, which could increase risk to child in crash.                     | Call 866-623-3139 to get lubricant for harness adjuster pivot pins.  |
| Dorel   | Alpha Omega or 3-in-1  | Many seats are more than 10 years old or have been recalled. Do not use if more than 10 years old or if date is unknown. |  |  |
| Dorel   | Alpha Omega (22-150, 22-151) or 3-In-1 (22-770)  | 10/1/05 to 12/31/05  | Child's finger may get stuck in small square hole in shell (near curved area on left side near edge of seat pad) | Call 877-639-0659 to order repair kit (black labels to cover openings)   |
| Dorel   | Alpha Omega or 3 in 1 (22-150, 22-180, 22-269, 22-151, 22-750, 22-770)                                 | 11/1/03 to 12/31/05  | Adjuster strap may slip in a crash, allowing the harness to loosen.  | Call 800-219-0509 or go to Dorel Web site to order kit with replacement harness adjuster strap.                            |
| Dorel   | Alpha Omega Elite (22148-49, 22154-55, -58, -88, -95, 22456, -59, -62, -65, 22755, -58, -59, -90, -99) | 5/1/08 to 4/30/09  | Harness may gradually loosen during normal use, which could increase risk to child in crash.                     | Call 866-623-3139 to get lubricant for harness adjuster pivot pins.  |
| Dorel   | Alpha Omega Elite or Deluxe 3 in 1 (22-155, 22-455, 22-755, 22-756, 22-757)                            | 11/1/03 to 12/31/05  | Adjuster strap may slip in a crash, allowing the harness to loosen.  | Call 800-219-0509 or go to Dorel Web site to order kit with replacement harness adjuster strap.                            |
| Dorel   | Arriva   | Many seats are more than 10 years old or have been recalled. Do not use if more than 10 years old or if date is unknown. |  |  |
| Dorel   | Avenue (22439, 22449)  | 5/1/08 to 4/30/09  | Harness may gradually loosen during normal use, which could increase risk to child in crash.                     | Call 866-623-3139 to get lubricant for harness adjuster pivot pins.  |

| MFR.  | MODEL NAME<br>(MODEL #)   | DATES<br>APPLICABLE   | PROBLEM   | ACTION REQUIRED  |
|-------|---|---|---|--|
| Dorel | Comfort Infant<br>(22-331, 22-332,<br>22-630, 22-631)                   | All made<br>before 2/28/06  | Base is very hard to install securely. Call 877-229-1374 for replacement base. [Not publicized]               |  |
| Dorel | Comfort Infant<br>(22-331, 22-332,<br>22-630, 22-631)                   | 7/26/05 to<br>2/28/06   | Screws in handle can loosen, posing a choking hazard. Does not affect crash performance.                      | Call 877-229-1374 for screw replacement kit.   |
| Dorel | Deluxe 3 in 1   |   | See Alpha Omega Elite   |  |
| Dorel | Deluxe Infant<br>(22-625)   | 8/19/03 to<br>10/20/04  | Strap ends can slip through adjusters, causing gradual loosening of harness.                                  | Call for clips to attach to ends of harness.   |
| Dorel | Deluxe Infant   | See recall at top of Dorel section.   |   |  |
| Dorel | Deluxe Convertible  | See Enspira   |   |  |
| Dorel | Deluxe 3-in-1   | See Alpha Omega Elite.  |   |  |
| Dorel | Designer 22<br>(02-621-SAL,<br>02-620-AZY,<br>02-620-BEA only)          | 1/3/02 to<br>2/13/02  | When used as carrier, handle may be accidentally released, allowing infant to fall out.                       | Call for repair kit. Do not use carry handle until repaired.   |
| Dorel | Designer 22<br>(22-300, 22-325,<br>22-625 with codes<br>ending in GB1B) | 8/19/03 to<br>10/20/04  | Strap ends can slip through adjusters, causing gradual loosening of harness.                                  | Call for clips to attach to harness strap ends.  |
| Dorel | Designer 22   | See recall at top of Dorel section.   |   |  |
| Dorel | Dream Ride<br>(22-001-FSM)  | 12/1/03 to<br>4/28/04   | When used in rear-facing mode, seat may rotate downward too far in a crash.                                   | Use only as side-facing car bed. Call Dorel for warning sticker and replacement seat, if rear-facing seat is needed. |
| Dorel | Dream Ride,<br>Dream Ride Ultra   | Many seats are more than 10 years old or have been recalled. Do not use if more than 10 years old or if date is unknown.  |   |  |
| Dorel | Echelon   | See Alpha Omega Elite.  |   |  |
| Dorel | Eddie Bauer   | See specific model name.  |   |  |
| Dorel | Enspira (22452-53,<br>22740-41, 22458)                                  | 5/1/08 to<br>4/30/09  | Harness may gradually loosen during normal use, which could increase risk to child in crash.                  | Call 866-623-3139 to get lubricant for harness adjuster pivot pins.  |
| Dorel | Enspira or Deluxe<br>Convertible<br>(22-450, 22-451,<br>22-740)         | 11/1/03 to<br>12/31/05  | Adjuster strap may slip in a crash, allowing the harness to loosen.   | Call 800-219-0509 or go to Dorel Web site to order kit with replacement harness adjuster strap.                      |
| Dorel | Enspira Overhead<br>Shield or Enspira<br>Versa-Fit (22-480,<br>22-481)  | 11/1/03 to<br>12/31/05  | Adjuster strap may slip in a crash, allowing the harness to loosen.   | Call 800-219-0509 or go to Dorel Web site to order kit with replacement harness adjuster strap.                      |
| Dorel | First Ride  | See recall at top of Dorel section.   |   |  |
| Dorel | High Back Booster<br>(generic)  | Note: Dorel identifies various models as "High Back Boosters," including several combination seats (used as child seat with harness or as booster after removing harness; with or without armrest; with front or rear harness adjuster) as well as boosters only (no harness included). |   |  |
| Dorel | High Back Booster   | Many seats are more than 10 years old or have been recalled. Do not use if more than 10 years old or if date is unknown.  |   |  |
| Dorel | High Back Booster<br>only some model<br>numbers                         | 3/15/02 to<br>8/01/02   | Harness webbing could degrade due to deterioration from ultraviolet light.                                    | Call 866-690-2539 for new harness. Check model number with Dorel.  |
| Dorel | High Rise (22-297,<br>22-298, 22-299)                                   | 10/1/03 to<br>10/31/03  | Label states booster is for use by children <i>under</i> one year of age; it should say <i>over</i> one year. | Call for replacement label.  |
| Dorel | Intera (22-460)   | 11/1/03 to<br>12/31/05  | Adjuster strap may slip in a crash, allowing the harness to loosen.   | Call 800-219-0509 or go to Dorel Web site to order kit with replacement harness adjuster strap.                      |

| MFR.  | MODEL NAME (MODEL #)  | DATES APPLICABLE   | PROBLEM   | ACTION REQUIRED   |
|---|---|--|---|---|
| Dorel   | Maxi-Cosi Mico (22356, 22371-72)  | 5/1/08 to 4/30/09  | Harness may gradually loosen during normal use, which could increase risk to child in crash.                            | Call 866-623-3139 for lubricant for harness adjuster pivot pins.  |
| Dorel   | Maxi-Cosi Mico (22-371,22-372) or base only (22-515)                                    | All made before 6/28/08  | Shell may not attach securely to base or may be difficult to detach.  | Call 877-657-9546 for kit to replace springs in base. Use without base until repaired.                                    |
| Dorel   | Maxi-Cosi Priori (22476, 22486)   | 5/1/08 to 4/30/09  | Harness may gradually loosen during normal use, which could increase risk to child in crash.                            | Call 866-623-3139 for lubricant for harness adjuster pivot pins.  |
| Dorel   | Olympian  | See Touriva  |   |   |
| Dorel   | onboard (22077-78, 22356)   | 5/1/08 to 4/30/09  | Harness may gradually loosen during normal use, which could increase risk to child in crash.                            | Call 866-623-3139 for lubricant for harness adjuster pivot pins.  |
| Dorel   | Prospect (22580, 22880)   | 5/1/08 to 4/30/09  | Harness may gradually loosen during normal use, which could increase risk to child in crash.                            | Call 866-623-3139 for lubricant for harness adjuster pivot pins.  |
| Dorel   | Regal Ride  | See Touriva.   |   |   |
| Dorel   | Safety 1st  | See specific model name.   |   |   |
| Dorel   | Scenera (22120-22128, 22160, 22162, 93120)  | All made before 3/24/08  | Harness webbing may be damaged if it slides over pointed guides on bottom of plastic shell. Keep webbing behind guides. | If damaged, call Dorel for replacement harness and instructions for keeping webbing in correct position. [Not publicized] |
| Dorel   | Starter   | See recall at top of Dorel section.  |   |   |
| Dorel   | SureFit (22657, 22346, IC072)   | 5/1/08 to 4/30/09  | Harness may gradually loosen during normal use, which could increase risk to child in crash.                            | Call 866-623-3139 for lubricant for harness adjuster pivot pins.  |
| Dorel   | Surveyor  | See Vantage Point.   |   |   |
| Dorel   | Three Car Seats in One  | See Alpha Omega.   |   |   |
| Dorel   | TLC   | Many seats are more than 10 years old or have been recalled. Do not use if more than 10 years old or if date is unknown. |   |   |
| Dorel   | Touriva, 5-point harness, T-shield, or overhead shield                                  | Many seats are more than 10 years old or have been recalled. Do not use if more than 10 years old or if date is unknown. |   |   |
| Dorel   | Touriva only some model numbers   | 3/15/02 to 8/01/02   | Harness webbing could degrade due to deterioration from ultraviolet light.  | Call 866-690-2539 for new harness. Check model number with Dorel.   |
| Dorel   | Touriva or Regal Ride, 5-point harness (22100TTD, 22100TIP, 2111FSM2, 2130WAL, 2139MON) | 9/28/04 to 9/20/07   | Elastic straps that secure cover to shell may come loose, allowing child to wrap them around parts of body.             | Call 888-698-6681 or visit Dorel Web site to order repair kit.  |
| Dorel   | Turnabout   | See Arriva.  |   |   |
| Dorel   | Uptown (22475)  | 5/1/08 to 4/30/09  | Harness may gradually loosen during normal use, which could increase risk to child in crash.                            | Call 866-623-3139 for lubricant for harness adjuster pivot pins.  |
| Dorel   | Vantage, Vantage Point (22546-47, -53, -54, -60, -61, -64, -67, -74)                    | 5/1/08 to 4/30/09  | Harness may gradually loosen during normal use, which could increase risk to child in crash.                            | Call 866-623-3139 for lubricant for harness adjuster pivot pins.  |
| <b>Do not use Cosco 5-Point (original model with metal frame and pedestal), AutoTrac, Commuter with split tray-shield, Comfort Ride (original model with shield and plastic pedestal), Explorer, Explorer 1, First Ride, Safe &amp; Easy, Safe &amp; Snug, Safe-T-Mate, Safe-T-Seat, Safe-T-Shield, Soft Shield (#02-090 to #02-190), Travel Hi-Lo. All made over 10 years ago; many had recalls.</b> |   |  |   |   |

| MFR.  | MODEL NAME (MODEL #)  | DATES APPLICABLE   | PROBLEM  | ACTION REQUIRED   |
|---|---|--|--|---|
| <b>Dorel models with no recalls, replacement parts, or warnings:</b> Adventurer II, Alpha Elite 65, Ambassador, Apex 65, Apt 40 RF, Aquos 65, Boost Air Protect, Chart 65 Air, Comfort High Back Booster, Comfort Ride, Comfy Carry (all models), Commuter, Complete Air (all models), Complete Voyager, Designer, Designer 35, Dream Ride SE, EasyFit 65, enRoute, Essential Air, Forerunner, Go Hybrid, Guide 65, Grand Explorer, High Rider, Maxi-Cosi Pria 70, Maxi-Cosi Rodi, onBoard 35, onBoard 35 Air, onSide Air Convertible, Opus 35, Portable Car Seat, Pronto, Protek, Rumi Air, Scenera 40RF, Summit, Summit Deluxe, Tote 'n Go, Travel Vest, Traveler, Triad, Ventura, Visions, Vista, Voyager, XRS 65. |   |  |  |   |
| <b>Downunder Design (out of business)</b><br>Do not use Kangaroo Booster. All made more than 10 years ago.  |   |  |  |   |
| <b>Dream On Me, 170 Circle Drive North, Piscataway NJ 08854, 732-748-1300, www.dreamonme.com</b>  |   |  |  |   |
| <b>Dream On Me models with no recalls, replacement parts, or warnings:</b> Mia Moda Certo (see also recall under Mia Moda)  |   |  |  |   |
| <b>Early Development Co. (out of business)</b> All models made over 10 years ago.   |   |  |  |   |
| <b>Easycarseat</b> (Inflatable booster available online). According to NHTSA, the manufacturer states that all of the boosters sold in the U.S. were withdrawn. Contact GOBOOSTER for more information.   |   |  |  |   |
| <b>Eddie Bauer. See Dorel Juvenile Group.</b>   |   |  |  |   |
| <b>Evenflo, 225 Byers Rd Miamisburg, OH 45342 , 800-233-5921, www.evenflo.com</b>   |   |  |  |   |
| Evenflo   | Champion/Scout/Trooper with tray-shield (#224)                        | Many seats are more than 10 years old or have been recalled. Do not use if more than 10 years old or if date is unknown. |  |   |
| Evenflo   | Comfort Touch   | Refer to specific model name. Comfort Touch is name of style/fabric.   |  |   |
| Evenflo   | Cozy Carry  | All  | The plastic tabs on the base could break if the shoulder belt is threaded under them. Call for a free "safety upgrade kit." Evenflo recommends removing shoulder belt from slots, allowing it to rest against vehicle seat. [Not publicized] |   |
| Evenflo   | Discovery with 3- or 5-pt harness (#390, 391, 534, 552)               | 4/27/05 to 1/29/08   | Safety seat shell could separate from base in high-impact side collision.  | Call 800-356-2229 or go to www.evenflo.com/Discovery to order dual-hook fastener strap. Until modification is completed, use seat without base. |
| Evenflo   | Discovery (3021769Z, 3021854Z)  | 2/4/08 only  | Some seats were made without complete assembly of red release handle located on the back. Under certain conditions, the shell could separate from its base, possibly resulting in serious injury.  | Call 800-233-5921 for a replacement safety seat. Until new seat is received, use without base.  |
| Evenflo   | Embrace (#317, 320, 397, 398, 540, 548, 549, 550, 556, 597, 598, 599) | All made before 4/8/06   | When used as carrier, handle can unexpectedly release, causing seat rotation and allowing infant to fall out.  | Call 800-490-7497 for repair kit. Do not use carry handle until repaired.   |
| Evenflo   | First Choice (3604098)  | 1/16/09 to 9/29/09   | Missing labels regarding contact information and aircraft certification.   | Call 800-233-5921 to order labels.  |
| Evenflo   | Fresh Air   | Refer to specific model name. Fresh Air is name of style/fabric.   |  |   |
| Evenflo   | Joy Ride  | Many seats are more than 10 years old or have been recalled. Do not use if more than 10 years old or if date is unknown. |  |   |
| Evenflo   | Maestro (#3101198, 3101980, 31011048, 31011049, 31011059)             | 12/17/09 to 4/26/10  | Plastic shell near harness adjuster may crack in a crash.  | Call Evenflo for reinforcement bracket. Do not use seat with harness until repaired; booster use for children over 40 lbs. OK.                  |
| Evenflo   | On My Way   | Many seats are more than 10 years old or have been recalled. Do not use if more than 10 years old or if date is unknown. |  |   |
| Evenflo   | OshKosh   | Refer to specific model name. OshKosh is name of style/fabric.   |  |   |
| Evenflo   | Scout   | See Champion   |  |   |
| Evenflo   | Secure Advantage  | See Ultra I  |  |   |
| Evenflo   | Travel Tandem (see also Joy Ride)                                     | Many seats are more than 10 years old or have been recalled. Do not use if more than 10 years old or if date is unknown. |  |   |

| MFR.   | MODEL NAME (MODEL #)   | DATES APPLICABLE   | PROBLEM   | ACTION REQUIRED                               |
|--|--|--|---|---|
| Evenflo  | Tribute, Tribute 5 (beginning with #378 or #379)   | 9/8/05 to 9/22/05  | Shell may crack in certain types of crashes when used rear-facing.                        | Call for free Tribute replacement.            |
| Evenflo  | Triumph  | 10/20/01 to 1/31/02  | Plastic slide loop connectors in the harness system could break in a crash.               | Call for a repair kit.                        |
| Evenflo  | Triumph (beginning with #264, 359, 389)  | 9/6/01 to 10/31/05   | If cloth cover is pulled back, child could break off piece of foam liner and choke on it. | Call 800-490-7591 to order protective sleeve. |
| Evenflo  | Trooper  | See Evenflo Champion/Scout/Trooper   |   |   |
| Evenflo  | Ultara I or II   | Many seats are more than 10 years old or have been recalled. Do not use if more than 10 years old or if date is unknown. |   |   |
| Do not use <b>Evenflo</b> 2-in-1, BeltRight, Bobby-Mac, Double Guard, Dyn-O-Mite, Evenflo Booster (split shield), Evenflo Convertible #410, Evenflo Infant, Evolution, One Click, One Step, SafeGuard, Secure Comfort, SecureRide, Seven Year, Sidekick and Sightseer (discontinued shield boosters), Wings, all Evenflo seats with red button in black housing. All made more than 10 years ago; many had recalls.  |  |  |   |   |
| <b>Evenflo models with no recalls, replacement parts, or warnings:</b> Amp, Apollo, Big Kid (all models), Bolero, Chase, Comet, Confidence, Conquest I and V, Embrace 35, Express, Generations, Generations 65, Horizon I and V, Medallion V, Momentum 65, Odyssey I and V, Orion, PortAbout, Right Fit, Secure Advantage V, Secure Choice, Secure Kid 300/400, SecureRide 35, Serenade, Sightseer (highback booster), Symphony, Symphony 65, Titan, Titan Elite, Titan Sport, Tot Taxi, Traditions, Tribute Sport, Triumph Advance 50, Triumph Advance 65, Ultara V (5-point harness), Vanguard, Victory. |  |  |   |   |
| <b>ExoMotion, 309 South Cloverdale Street, Unit B 12, Seattle WA 98108, 866-870-2122, www.exomotion.com</b>  |  |  |   |   |
| <b>Distributor for Recaro Monza Reha (no recalls)</b>  |  |  |   |   |
| <b>E-Z-ON Products, 605 Commerce Way West, Jupiter, FL 33458, 800-323-6598, www.ezonpro.com</b>  |  |  |   |   |
| <b>E-Z-On models with no recalls, replacement parts, or warnings:</b> Vests and Harnesses  |  |  |   |   |
| <b>FBS. See Renolux.</b>   |  |  |   |   |
| <b>Fisher-Price, 636 Girard Ave., East Aurora, NY 14052, 800-432-5437, www.fisher-price.com</b>  |  |  |   |   |
| Fisher-Price   | Safe Embrace Convertible (#79700)  | Many seats are more than 10 years old or have been recalled. Do not use if more than 10 years old or if date is unknown. |   |   |
| Do not use <b>Fisher-Price</b> Infant Car Seat (#9149, 9173), Safe Embrace Infant, T-Shield Car Seat (9100, 9101, 9102), T-Shield Booster, Deluxe/Bolster Car Seat (#9104). All made more than 10 years ago; many had recalls.   |  |  |   |   |
| <b>Fisher-Price models with no recalls, replacement parts, or warnings:</b> Futura 20/60, Grow-with-Me, Safe Embrace Booster, Safe Embrace II Convertible (with LATCH), Safe Voyage Convertible, Safe Voyage Deluxe Convertible, Safe Voyage Booster, Safe Voyage Infant, Stay-in View Infant  |  |  |   |   |
| <b>Ford Motor Company</b>  |  |  |   |   |
| Do not use <b>Ford</b> Tot-Guard. All made more than 10 years ago.   |  |  |   |   |
| <b>Gerry Baby Products (out of business; purchased by Evenflo)</b>   |  |  |   |   |
| <b>Do not use Gerry</b> BeltRight, Double Guard, Double Guard Sport, Evolution, Guard with Glide, Guardian, One-Click, Pro-Ride, Pro-Tech, SecureLock, SecureRide, Super Shield, Voyager. All made more than 10 years ago; many had recalls.   |  |  |   |   |
| <b>GOBOOSTER USA LLC, P.O. Box 542516, Lake Worth, FL 33454, 888-327-4236 http://gobooster.com</b>   |  |  |   |   |
| <b>GOBOOSTER models with no recalls, replacement parts, or warnings:</b> GOBOOSTER   |  |  |   |   |
| <b>Graco Children's Products, 150 Oaklands Blvd, Exton, PA 19341, 800-345-4109 www.gracobaby.com.</b>  |  |  |   |   |
| Note: <b>Graco</b> is the parent company of <b>Century Products Division.</b>  |  |  |   |   |
| Graco (Century)  | 530, 560, 565, 590, Affinity Assura (45xx)   | Many seats are more than 10 years old or have been recalled. Do not use if more than 10 years old or if date is unknown. |   |   |
| Graco (Century)  | 1000/1500 STE (41xx)<br>2000/2500 STE (42xx)<br>3000/3500 STE (43xx)<br>5000/5500 STE (44xx) | Many seats are more than 10 years old or have been recalled. Do not use if more than 10 years old or if date is unknown. |   |   |
| Graco (Century)  | Accel (45100, 45200, 45600, 45700)   | Many seats are more than 10 years old or have been recalled. Do not use if more than 10 years old or if date is unknown. |   |   |

| MFR.   | MODEL NAME (MODEL #)  | DATES APPLICABLE   | PROBLEM  | ACTION REQUIRED   |
|--|---|--|--|---|
| Graco (Century)  | Affinity  | See 590  |  |   |
| Graco (Century)  | Assura  | See 565  |  |   |
| Graco (Century)  | Bravo (44622, 44630, 44631, 44662)  | Many seats are more than 10 years old or have been recalled. Do not use if more than 10 years old or if date is unknown. |  |   |
| Graco (Century)  | Breverra Ascend   | All before 9/02  | LATCH drawings in instructions (p. 10-11) have been corrected to show hooks pointing downward. [Not publicized]                                      |   |
| Graco (Century)  | Encore (44612, 4662)  | Many seats are more than 10 years old or have been recalled. Do not use if more than 10 years old or if date is unknown. |  |   |
| Graco (Century)  | NextStep  | All before 9/02  | LATCH drawings in instructions (p. 10-11) have been corrected to show hooks pointing downward. [Not publicized]                                      |   |
| Graco (Century)  | SmartFit (45xx)   | Many seats are more than 10 years old or have been recalled. Do not use if more than 10 years old or if date is unknown. |  |   |
| Graco (Century)  | SmartMove (4750) with tray-shield   | Many seats are more than 10 years old or have been recalled. Do not use if more than 10 years old or if date is unknown. |  |   |
| Graco (Century)  | SmartMove (44709)   | Many seats are more than 10 years old or have been recalled. Do not use if more than 10 years old or if date is unknown. |  |   |
| Graco  | CarGo (#8D02, 8D03)   | 1/9/07 to 3/3/08   | Incorrect phone number for NHTSA on sticker.   | Call Graco for correct sticker.   |
| Graco  | Comfort Sport with 5-pt harness (8433, 8629-39, 8C00-04)                          | 1/2/07-7/31/07   | The LATCH strap may be incorrectly routed over instead of under the harness straps, allowing excessive rotation of rear-facing seat in a crash.      | Call Graco or view drawing on Web site and correct strap routing before installing with LATCH.  |
| Graco  | Comfort Sport with 5-pt harness (#8C04FRR, 8C04FRR2)                              | 11/1/06 to 10/8/07   | Body pillow partially covers airbag warning label on seat cover.   | Remove pillow, which is an optional comfort feature.  |
| Graco  | Infant Carrier or LiteRider   | See SnugRide   | Graco  | Infant Carrier or LiteRider   |
| Graco  | Platinum CarGo (#8689, 8D01, 8D04, 8D05, 8D10)                                    | 1/9/07 to 3/3/08   | Incorrect phone number for NHTSA on sticker.   | Call Graco for correct sticker.   |
| Graco  | SnugRide (all models with base)   | 8/31/99 to 2/28/02   | Metal parts may be missing from base or carrier, which could allow the carrier to detach from the base in a crash.                                   | Until checked and/or repaired, use seat without base. Call for inspection details.  |
| Graco  | SnugRide stand-alone models (not sold with stroller) made in USA                  | 3/01/02 to 3/08/03   | Metal "U-bars" used to attach carrier to base may be missing from bottom of carrier, allowing carrier to detach from base in a sudden stop or crash. | Use carrier without base until checked and/or replaced. Go to <a href="http://www.gracobaby.com">www.gracobaby.com</a> or call for inspection details. If bars are missing, ask for replacement seat. |
| Graco  | SnugRide (#8609, 8616, 8643, 8645, 8646) Does not apply if part of travel system. | 8/1/06 to 6/30/07  | Backing of seat pad could pull away from seams, possibly allowing child to break off a piece of foam and choke on it.                                | Call Graco or go to their Web site to order kit with replacement cover.   |
| Graco  | SnugRide  | Many seats are more than 10 years old or have been recalled. Do not use if more than 10 years old or if date is unknown. |  |   |
| Graco  | Treasured CarGo (#8686)   | 1/9/07 to 3/3/08   | Incorrect phone number for NHTSA on sticker.   | Call Graco for correct sticker.   |
| Graco  | Ultra CarGo (#8487)   | 1/9/07 to 3/3/08   | Incorrect phone number for NHTSA on sticker.   | Call Graco for correct sticker.   |
| Graco (Century)  | STE   | see 1000, 2000, 3000, 5000, etc.   |  |   |
| Do not use <b>Century</b> 100, 200, 300, 400XL, 570, 580, Breverra Sport, Child Love Seat, Commander, Infant Love Seat, Nexus. <b>Do not use Graco</b> GT 1000, Little Trav'ler, Snug Seat. All made more than 10 years ago; many had recalls. |   |  |  |   |

| MFR.   | MODEL NAME<br>(MODEL #)                            | DATES<br>APPLICABLE | PROBLEM   | ACTION REQUIRED  |
|--|--|---------------------|---|--|
| <b>Graco or Century models with no recalls, replacement parts, or warnings. Century:</b> Argos 70, Avanta, Breverra, Breverra Contour, Breverra Premiere, Breverra Metro/Transit, CR-3; Celestia, Cherished CarGo, Classic Ride 50, Ovation, Room-to-Grow, Vante. <b>Graco:</b> AirBooster, Assura (some Century Assuras have recalls), CarGo Express, Cherish Car Bed, Grand CarGo, Infant Safe Seat, My CarGo, MyRide 65, Nautilus, Nautilus Elite, Quest, Smart Seat, SnugRide 30, SnugRide 32, SnugRide 35, Toddler Safe Seat, Turbo Booster (all models). |  |                     |   |  |
| <b>Harmony Juvenile Products, 1600 53rd Street, North Bergen, NJ 07047, 877-306-1001, www.harmonyjuvenile.com</b>  |  |                     |   |  |
| <b>Harmony models with no recalls, replacement parts, or warnings:</b> Baby Armor, Cruz, Dreamtime Comfort, LiteRider, Olympian, Youth Booster.  |  |                     |   |  |
| <b>IMMI See SafeGuard</b>  |  |                     |   |  |
| <b>International (out of business).</b> Do not use Astrorider, Teddy Tot Astroseat. All made more than 10 years ago.   |  |                     |   |  |
| <b>Jané USA, P.O. Box 410007, San Francisco, CA 94141, 415-824-1237, www.janeusa.com</b>   |  |                     |   |  |
| <b>Jané USA models with no recalls, replacement parts, or warnings:</b> Indy, Indy Plus, Team, Team Plus   |  |                     |   |  |
| <b>Jeffco Fibres, 451 Quarry St. Fall River, MA 02722 508-673-1001, www.jeffcofibres.com (out of safety seat business)</b>   |  |                     |   |  |
| <b>Jeffco or LaRoche models with no recalls, replacement parts, or warnings:</b> Grizzly Bear, Polar Bear, Teddy Bear  |  |                     |   |  |
| <b>Jupiter Industries, 1399 Kennedy Rd., #22, Scarborough, Ontario M1P2L6 Canada, 800-465-5795, 416-285-7525, www.jupiterindustries.com</b>  |  |                     |   |  |
| <b>Jupiter models with no recalls, replacement parts, or warnings:</b> Komfort Kruiser, Komfort Rider (all models)   |  |                     |   |  |
| <b>Kantwet (out of business).</b> Do not use One Step. All models made more than 10 years ago.   |  |                     |   |  |
| <b>KIDSEmbrace, 3940 Laurel Canyon Blvd., Suite #1172, Studio City, CA 91604 , 866-947-3287, kidsembrace.com</b>   |  |                     |   |  |
| <b>KidsEmbrace models with no recalls, replacement parts, or warnings:</b> Toddler/Booster Seat (various character names)  |  |                     |   |  |
| <b>Kolcraft Enterprises, 1100 W. Monroe St., Chicago, IL 60607, 800-453-7673, www.kolcraft.com</b>   |  |                     |   |  |
| Do not use <b>Kolcraft</b> Auto-Mate with T-Shield, Carter's Travel 5, Dial-A-Fit, Dial-A-Fit II, Flip & Go, Flip & Go II, Hi-Rider, Infant Rider, Perfect Fitt, Performa, Playskool Infant, Playskool Convertible, Plus 4, Plus 5, Quick-Step, Prodigy, Redi-Rider, Rock 'n Ride, Secura, Secure-Fit, Tot-Rider, Travel About, Traveler 700, Ultra Ride. All made more than 10 years ago; many had recalls.   |  |                     |   |  |
| <b>LaRoche Brothers See Jeffco</b>   |  |                     |   |  |
| <b>Learning Curve 1111 West 22nd St, Ste 320 Oak Brook, IL 60523 888-899-2229, www.learningcurve.com</b>   |  |                     |   |  |
| Learning Curve   | Infant Car Seat I 420 (fabric codes ARD, FUO, MAR) | 5/07/06 to 5/15/06  | Metal slide on end of crotch strap may not be installed correctly, which could cause crack in shell during crash. | Check that slide lies flat against shell in the correct location. Call 888-899-2229            |
| <b>Learning Curve and Compass models with no recalls, replacement parts, or warnings:</b> I 410, Via (all models), Compass Folding Adjustable Boosters (all models), Recline Convertible, Premier Rebound, True Fit, True Fit Deluxe, True Fit Premier   |  |                     |   |  |
| <b>Lenox Juvenile Group, 100 SW 52<sup>nd</sup> Ave, Ocala, FL 34474</b>   |  |                     |   |  |
| <b>Lenox models with no recalls, replacement parts, or warnings:</b> Tattle Tale Convertible, Tattle Tale Toddler/Booster  |  |                     |   |  |
| <b>Lilly Gold Div. TriplePlay Products, 10275 Wayzata Bl. #280 Minnetonka, MN 55305, 800-829-1625 www.lilygold.com</b>   |  |                     |   |  |
| Lilly Gold   | Sit'n Stroll (#4002)                               | 5/5/08              | Center adjuster webbing does not comply with required breaking strength.  | Call for repair kit and instructions to replace webbing.                                       |
| <b>Lin Lih (illegally imported car seats to U.S.)</b>  |  |                     |   |  |
| Lin Lih  | Lin Lih, World Toys, MCP                           | All                 | Fails crash test. Dummy was ejected.  | Call SafetyBeltSafe U.S.A. for info and then destroy or donate to safety program for training. |
| <b>Little Cargo, 1515 Warson, #153, St. Louis, MO 63132, 800-933-8580</b>  |  |                     |   |  |
| <b>Little Cargo model with no recalls, replacement parts, or warnings:</b> Auto Safety Vest  |  |                     |   |  |
| <b>Magna Aftermarket America. See Clek.</b>  |  |                     |   |  |
| <b>Maxi-Cosi. See Dorel.</b>   |  |                     |   |  |

| MFR.  | MODEL NAME<br>(MODEL #)                        | DATES<br>APPLICABLE  | PROBLEM  | ACTION REQUIRED   |
|---|--|--|--|---|
| <b>Mercedes-Benz USA, Accessories, P.O. Box 350, Montvale, NJ 07645, www.mbusa.com</b>  |  |  |  |   |
| Mercedes  | Baby-Smart Infant, Booster                     | Many seats are more than 10 years old or have been recalled. Do not use if more than 10 years old or if date is unknown. |  |   |
| Mercedes-Benz   | Topsafe  | 3/1/03 to 11/30/03   | LATCH attachments may fail in a crash, releasing the safety seat.  | Go to dealer for refund (Recall Campaign #2004 120005). Use vehicle belt for installation until seat is replaced.   |
| <b>Mercedes model with no recalls, replacement parts, or warnings: Mercedes Booster, Duo, Kid, Toddler</b>                              |  |  |  |   |
| <b>Merritt Manufacturing, P. O. Box 17152, Indianapolis, IN 46217, 317-409-0148, www.eztether.com</b>                                   |  |  |  |   |
| <b>Merritt Manufacturing models with no recalls, replacement parts, or warnings: Churchhill, Hope Car Bed, Roosevelt</b>                |  |  |  |   |
| <b>Mia Moda Inc., 170 Circle Drive North Piscataway, NJ 08854, 866-642-6632 www.miamodainc.com</b>                                      |  |  |  |   |
| Mia Moda (See also Dream On Me)   | Viva, Viva Supreme (#5000-5081)                | All (discontinued 4-30-09)   | (1) Splitter plate has sharp edges which can cut harness.<br>(2) Base could crack in a crash.  | Do not use. Go to www.vivacarseatrecall.com or call Lerado Group USA (877-546-8437) for refund.   |
| <b>Nania. See Team Tex America.</b>   |  |  |  |   |
| <b>Nissan North America, 18501 S. Figueroa St., Gardena, CA 90248, www.nissanusa.com</b>  |  |  |  |   |
| Do not use Nissan Infant/Child Seat, Child Seat. All made more than 10 years ago; many had recalls.                                     |  |  |  |   |
| <b>Orbit Baby Inc., 5437 Central Avenue, Suite 10, Newark, CA 94560, 877-672-2229, www.orbitbaby.com</b>                                |  |  |  |   |
| Orbit Baby  | Orbit Base                                     | All before 2/1/08  | Original base sold with Infant Car Seat is not compatible with Toddler Car Seat.   | Call or go to Web site for upgrade.   |
| <b>Orbit Baby Inc. models with no recalls, replacements parts, or warnings: Orbit Infant, Orbit Toddler (also G2 models)</b>            |  |  |  |   |
| <b>Peg-Perego U.S.A., 3625 Independence Dr, Fort Wayne, IN 46808, 800-671-1701, www.perego.com</b>                                      |  |  |  |   |
| Peg-Perego  | Primo Viaggio (may be part of stroller system) | All before 1/02  | May be impossible to tighten harness to fit a small baby. Call 800-671-1701 for replacement harness. [Not publicized]  |   |
| Peg-Perego  | Primo Viaggio (may be part of stroller system) | 5/20/01 to 2/15/02   | If there is a snap connecting fabric to plastic cover on harness adjuster, tension on fabric caused by weight of child can prevent adjuster from locking fully, allowing harness to slip.  | Remove original cover immediately (call 877-737-3468 for instructions). Registered owners will receive new plastic cover. Do not use with old cover in place. |
| Peg Perego  | Primo Viaggio SIP 30-30                        | 7/1/07 to 3/15/08  | Plastic housing on harness adjuster may have sharp edge that scratches child's feet.   | Call 888-734-6030 to order replacement adjuster cover.  |
| Peg Perego  | Primo Viaggio                                  | All models with stroller base that has front bar   | Stroller use: To prevent possibility of baby's fall due to incorrect placement of seat on stroller, make sure that front bar is installed on stroller and that seat is latched firmly to stroller with two hooks. Test by yanking seat toward front of stroller. |   |
| <b>Peg Perego model with no recalls, replacement parts, or warnings: Primo Viaggio SIP ES 30-30, Primo Viaggio SIP 5-70 Convertible</b> |  |  |  |   |
| <b>Playskool. See Kolcraft.</b>   |  |  |  |   |
| <b>Porsche Cars of North America. Contact Britax.</b>   |  |  |  |   |
| <b>Porsche models with no recalls, replacement parts, or warnings: Baby-Safe, Porsche Convertible, Prince, Zoom</b>                     |  |  |  |   |
| <b>Pride Trimble (out of business). Do not use Click 'N Go, Pride Ride. All made more than 10 years ago.</b>                            |  |  |  |   |
| <b>Prodigy (out of business). Do not use Kiwi, Shuttle. All made more than 10 years ago.</b>  |  |  |  |   |
| <b>ProRider, 1620 Industry Drive SW #C, Auburn, WA 98001, 800-642-3123, www.prorider.com/nonprofit/</b>                                 |  |  |  |   |
| <b>ProRider model with no recalls, replacement parts, or warnings: CNS Booster, ProRider Booster</b>                                    |  |  |  |   |
| <b>Questor (out of business). Do not use Dyn-O-Mite. All made more than 10 years ago.</b>   |  |  |  |   |

| MFR.  | MODEL NAME (MODEL #)                                | DATES APPLICABLE   | PROBLEM  | ACTION REQUIRED  |
|---|---|--|--|--|
| <b>Recaro Child Safety Systems North America, 1600 Harmon Rd., Auburn Hills, MI 48326, 888-973-2276</b><br><b>www.recaro-cs.com</b>   |   |  |  |  |
| Recaro  | Como or Signo                                       | All made before 12/18/07   | Looped ends of harness may become disconnected from harness connector (metal splitter plate) when child is placed in or removed from seat.   | Call for kit with two rubber caps to prevent harness loops from slipping off by closing gaps.  |
| Recaro  | Como or Signo (model numbers start with 330 or 331) | 11/1/07 to 2/16/09   | If metal frame around harness release lever is gold, adjuster may be defective, allowing front adjuster strap to slip so harness is loose on child. If metal frame is silver, adjuster is not defective. | Check adjuster by tightening harness, then pulling on shoulder straps to see if harness loosens. Call 888-473-2290 or go to recarokids.com for instructions to test adjuster and to request replacement seat if necessary. |
| <b>Recaro models with no recalls, replacement parts, or warnings:</b> Como G2, Euro, ProBooster, ProRide, ProSport, Signo G2, Start, Vivo, Vivo Lite, Young Sport, Young Style. See also Exomotion.   |   |  |  |  |
| <b>Renolux (FBS) (out of business)</b>  |   |  |  |  |
| Do not use <b>Renolux</b> #2000, #4000, #5000, #7000, GT-2000 with puzzle buckle (also labeled Champion Children's Products, GT-1000 or FBS Model 200), GT-5000 (Turn-A-Tot or #500), Renolux Booster. All made more than 10 years ago; many had recalls. |   |  |  |  |
| <b>Safe Traffic System Inc, 3343 W. Eastwood Ave., Chicago, IL 60625, 847-329-8111, www.safetrafficsystem.com</b>   |   |  |  |  |
| <b>Safe Traffic System models with no recalls, replacement parts, or warnings:</b> RideSafer Travel Vests   |   |  |  |  |
| <b>SafeGuard, 18881 US 31 North, P.O. Box 408, Westfield, IN 46074, 800-586-7839, www.safeguardseat.com</b>   |   |  |  |  |
| <b>SafeGuard models with no recalls, replacement parts, or warnings:</b> SafeGuard, SafeGuard Go.   |   |  |  |  |
| <b>Safeline Corp. or Safeline Kids (out of child restraint business 2004). Contact Lilly Gold.</b>  |   |  |  |  |
| Safeline  | Sit'n Stroll  | Many seats are more than 10 years old or have been recalled. Do not use if more than 10 years old or if date is unknown. |  |  |
| Safeline Kids   | Sit'n Stroll #2003                                  | 9/1/02 to 10/21/03   | Use of lower forward-facing belt path (labeled 20-28lb) may allow excessive head movement in a crash. Harness pads may interfere with tightening the straps.   | Use only top belt path for forward-facing installation, and don't use shoulder and buckle pads provided. Call for label and instructions dated 10/03.  |
| <b>Safeline models with no recalls, replacement parts, or warnings:</b> Booster Seat (Mission Control, Pilot)   |   |  |  |  |
| <b>Safety Angel/Safe Start, P.O. Box 740151, Boynton Beach, Florida 33474, 561-732-1233, www.safetyangel.com</b>  |   |  |  |  |
| <b>Safety Angel model with no recall:</b> Ride Ryte   |   |  |  |  |
| <b>Safety 1<sup>st</sup>. See Dorel Juvenile Group.</b>   |   |  |  |  |
| <b>Safety Baby. See Team Tex America.</b>   |   |  |  |  |
| <b>Sammons Preston Rolyan, 1000 Remington Blvd, Bolingbrook, IL 60440, 800-323-5547, www.sammonspreston.com</b>   |   |  |  |  |
| <b>Sammons Preston Rolyan models with no recalls, replacement parts, or warnings:</b> Tumble Forms Carrie Seats   |   |  |  |  |
| <b>Snug Seat. Box 1739, Matthews, NC 28106, 800-336-7684, www.snugseat.com</b>  |   |  |  |  |
| Snug Seat   | Gorilla tether kit FW-50250-12-ZY                   | 7/26/02 to 1/15/03   | A washer is not resistant to salt spray.   | Call Snug Seat for replacement washer and instructions.  |
| Snug Seat   | Spelcast tether kit FW-50250-12-ZY                  | 7/26/02 to 1/15/03   | A washer is not resistant to salt spray.   | Call Snug Seat for replacement washer and instructions.  |
| Snug Seat   | Traveller Plus                                      | All through 7/23/04  | The 1.5" adjuster strap may slip, allowing the harness to loosen. (Original models with 1" adjuster straps sold by Britax are not affected.)   | Do not use if harness can be loosened by pulling on straps without lifting release lever. Call Britax for replacement adjuster strap with thicker weave pattern.   |
| <b>Snug Seat models with no recalls, replacement parts, or warnings:</b> Hippo, Pilot, SS1000, Snug Seat 1 or 2, Snug Seat Car Bed, Traveller Plus EL, Wee Go   |   |  |  |  |
| <b>Strolee of California (out of business). See also Combi-Strolee for models made 2004 and later.</b>  |   |  |  |  |
| Do not use <b>Strolee</b> #595, #598, #599 #605, #609-610, #612-#629, #601-#604, GT-2000, GT-3000. All made more than 10 years ago; many had recalls.   |   |  |  |  |

| MFR.   | MODEL NAME<br>(MODEL #)       | DATES<br>APPLICABLE                 | PROBLEM   | ACTION REQUIRED                                       |
|--|-------------------------------|-------------------------------------|---|---|
| <b>Summer Infant, 1275 Park East Drive, Woonsocket, Rhode Island 02895, 800-268-6237, www.summerinfant.com</b>   |                               |                                     |   |   |
| <b>Summer Infant models with no recalls, replacement parts, or warnings: Prodigy</b>   |                               |                                     |   |   |
| <b>Sunshine Kids Juvenile Products: See Diono</b>  |                               |                                     |   |   |
| <b>Team-Tex America (formerly Car Seat Specialty), P. O. Box 3194, Rock Hill, SC 29732, 877-912-1313</b>   |                               |                                     |   |   |
| Team-Tex   | Baby Ride<br>(374099, 374199) | 8/31/06 to<br>10/23/06,<br>12/18/08 | Belt routing label with the<br>"horizontal reference line" is<br>incorrectly placed on the child<br>restraint system. | Call for correct label and<br>placement instructions. |
| <b>Team-Tex models with no recalls, replacement parts, or warnings: Dreamway SP, HighRide</b>  |                               |                                     |   |   |
| <b>Car Seat Specialty models with no recalls, replacement parts, or warnings: Airway, Baby One, Baby Ride, Basic, Dreamer, Duo, HighRide, Nuevo, Ola, Polo, Solo, Speedway, Topper, Uno.</b> |                               |                                     |   |   |
| <b>Teutonia USA, 150 Oaklands Boulevard, Exton, PA 19341, 877-838-8664, www.teutoniausa</b>  |                               |                                     |   |   |
| <b>Teutonia models with no recalls, replacement parts, or warnings: T-Tario 32, T-Tario 35</b>   |                               |                                     |   |   |
| <b>TriplePlay Products See Lilly Gold</b>  |                               |                                     |   |   |
| <b>Volvo Cars of North America, 7 Volvo Drive, Rockleigh, NJ 07647, 800-458-1552, new.volvocars.com</b>  |                               |                                     |   |   |
| Do not use <b>Volvo</b> Infant-Child Seat. All made more than 10 years ago and recalled.   |                               |                                     |   |   |
| <b>Volvo models with no recalls, replacement parts, or warnings: Child Booster or Child Cushion and Backrest</b>   |                               |                                     |   |   |
| <b>Welsh (out of business).</b> Do not use Travel Tot. All made more than 10 years ago. Many had recalls.  |                               |                                     |   |   |
| <b>Wonda Chair. See Babyhood.</b>  |                               |                                     |   |   |
| <b>Xportation Safety Concepts (out of business).</b>   |                               |                                     |   |   |
| Xportation   | Pioneered Infant<br>Car Seat  | All before<br>3/7/02                | Cradle holding baby can detach<br>from deflector base in a crash.   | Do not use.   |
| <b>Z.B. Sales (out of business).</b> Do not use Bobob, Bobob 2. All made more than 10 years ago.   |                               |                                     |   |   |